

Work Order ID 85322

85322

Page 1

June-05-12 3:38:09 PM.

Item ID: D407-667-205TRN

Accept

N900040100

Setup Start ***NS1***

Revision ID:

Stop ***NS2***

Item Name: Crosstube Turning Detail

Start Date: 05/06/2012 Start Qty: 1.00

1

Cust Item ID:

Required Date: 19/06/2012 Req'd Qty: 1.00

1

Customer:

Reference:

Approvals: Process Plan: MLJ

Date: 12/06/06 Tooling:

Date:

Run Start ***NR1***

QC:

Date: SPC (Y/N):

Date:

Stop ***NR2***

Sequence ID/ Work Center ID	Operation Description	Set Up/ Run Hours	Tool ID	Tool #	Plan Code	Accept Qty	Reject Qty	Reject Number	Insp. Stamp
--------------------------------	--------------------------	----------------------	---------	--------	--------------	---------------	---------------	------------------	----------------

Draw Nbr

Revision Nbr

D407-667-245

Rev F

100

0.00

100

MORI SEIKI CNC LATHE LARGE

Mori Seiki

Memo

0.00

Mori Seiki CNC Lathe Large

1-Fill tube with sand & install plugs DT8531 on both ends as per Folio FA248

2-Turn first side as per Folio FA248

3-Blend transition lines only, **do not sand whole tube**:

FOLIO REV: AA

DWG REV: E

*Use mill bastard file, brush file repeatedly with file card.

*Do not use sandpaper coarser than 320 grit.

110

QC1- Inspect dimensions to dimension sheet

0.00

110

QC

Memo

0.00

Quality Control

mmml
12/08/20

mmml
12/08/20

NCR: Yes / No

WORK ORDER NON-CONFORMANCE / UPDATE

DQA: _____ Date: _____

QA Closed: _____ Date: _____

Work Order: _____ Part No. _____ NCR No. _____	DISPOSITION Rework <input type="checkbox"/> Scrap <input type="checkbox"/> Use-as-is <input type="checkbox"/> Work Order Update <input type="checkbox"/>	AGAINST DEPARTMENT/PROCESS <table style="width: 100%;"> <tr> <td>Skid-tube <input type="checkbox"/></td> <td>Crosstube <input type="checkbox"/></td> <td>Prod. Eng. Coord. <input type="checkbox"/></td> <td>Engineering <input type="checkbox"/></td> </tr> <tr> <td>Machining <input type="checkbox"/></td> <td>Small Fab <input type="checkbox"/></td> <td>Rec/Store/Packaging <input type="checkbox"/></td> <td>Quality <input type="checkbox"/></td> </tr> <tr> <td>Thermoforming <input type="checkbox"/></td> <td>Finishing <input type="checkbox"/></td> <td>Supplier <input type="checkbox"/></td> <td></td> </tr> <tr> <td>Large Fab <input type="checkbox"/></td> <td>Composite <input type="checkbox"/></td> <td>Other <input type="checkbox"/></td> <td></td> </tr> </table>	Skid-tube <input type="checkbox"/>	Crosstube <input type="checkbox"/>	Prod. Eng. Coord. <input type="checkbox"/>	Engineering <input type="checkbox"/>	Machining <input type="checkbox"/>	Small Fab <input type="checkbox"/>	Rec/Store/Packaging <input type="checkbox"/>	Quality <input type="checkbox"/>	Thermoforming <input type="checkbox"/>	Finishing <input type="checkbox"/>	Supplier <input type="checkbox"/>		Large Fab <input type="checkbox"/>	Composite <input type="checkbox"/>	Other <input type="checkbox"/>	
Skid-tube <input type="checkbox"/>	Crosstube <input type="checkbox"/>	Prod. Eng. Coord. <input type="checkbox"/>	Engineering <input type="checkbox"/>															
Machining <input type="checkbox"/>	Small Fab <input type="checkbox"/>	Rec/Store/Packaging <input type="checkbox"/>	Quality <input type="checkbox"/>															
Thermoforming <input type="checkbox"/>	Finishing <input type="checkbox"/>	Supplier <input type="checkbox"/>																
Large Fab <input type="checkbox"/>	Composite <input type="checkbox"/>	Other <input type="checkbox"/>																

Root Cause	Date	Step	Qty	Description of work order update or Non-conformance	Initial Chief Eng	Action Description	Sign & Date	Verification	QC Inspector
Doc/Data									
Equip/Tooling									
Operator									
Material									
Offset/Setup									
Other									
Process									
Supplier									
Training									
Unauthorized									

FAULT CATEGORY

Landing Gear	Hardware	General	
<input type="checkbox"/> Bending Passes Below Min <input type="checkbox"/> Centre Not Concentric to O/S <input type="checkbox"/> Cracks <input type="checkbox"/> Crushed/Crimp at Bending <input type="checkbox"/> Inspection Strip in Tube <input type="checkbox"/> Other <input type="checkbox"/> Positioned Wrong <input type="checkbox"/> Ripples on Inner Bend <input type="checkbox"/> Torque Waves in Extrusion <input type="checkbox"/> Turning Sequence <input type="checkbox"/> Wave/Twist in Tube	<input type="checkbox"/> Breaking <input type="checkbox"/> Missing <input type="checkbox"/> Size/Length <input type="checkbox"/> Spinning <input type="checkbox"/> Threading <input type="checkbox"/> Wrong Drill Holes <input type="checkbox"/> Misaligned <input type="checkbox"/> Ovalized <input type="checkbox"/> Over/Undersized <input type="checkbox"/> Too Many	<input type="checkbox"/> Burrs <input type="checkbox"/> Contamination <input type="checkbox"/> Cut Too Short <input type="checkbox"/> Documentation/Data <input type="checkbox"/> Finish <input type="checkbox"/> Inspection Incomplete <input type="checkbox"/> Inspection Unqualified <input type="checkbox"/> Instructions Incomplete/Unclear <input type="checkbox"/> Jigs/Fixtures/Tooling <input type="checkbox"/> Kit Incorrect <input type="checkbox"/> Kit Missing	<input type="checkbox"/> Maintenance <input type="checkbox"/> Mislabeled <input type="checkbox"/> Off-Set <input type="checkbox"/> Orientation Misread <input type="checkbox"/> Out of Calibration <input type="checkbox"/> Out of Sequence <input type="checkbox"/> Outside Dimensions <input type="checkbox"/> Over/Under tolerance <input type="checkbox"/> Part Lost <input type="checkbox"/> Part Moved <input type="checkbox"/> Raw Material <input type="checkbox"/> Set-up <input type="checkbox"/> Supplier <input type="checkbox"/> Temperature/Cure <input type="checkbox"/> Weld <input type="checkbox"/> Wrong Stock Pulled <input type="checkbox"/> Other

Work Order ID 85322

June-05-12 3:38:09 PM

85322

Page 2

Item ID: D407-667-205TRN

Accept

N900040100

Setup Start

NS1

Revision ID:

Stop

NS2

Item Name: Crosstube Turning Detail

Start Date: 05/06/2012 Start Qty: 1.00

1

Cust Item ID:

Required Date: 19/06/2012 Req'd Qty: 1.00

1

Customer:

Reference:

Approvals:

Process Plan:

Date:

Tooling:

Date:

Run Start

NR1

QC:

Date:

SPC (Y/N):

Date:

Stop

NR2

Sequence ID/
Work Center ID

Operation
Description

Set Up/
Run Hours

Tool ID Tool #

Plan
Code

Accept
Qty

Reject
Qty

Reject
Number

Insp.
Stamp

120

0.00

120

MORI SEIKI CNC LATHE LARGE

Mori Seiki

Memo

0.00

Mori Seiki CNC Lathe Large

1-Turn second side as per Folio FA248

2-Blend transition lines only, **do not sand whole tube**:

*Use mill bastard file, brush file repeatedly with file card.

*Do not use sandpaper coarser than 320 grit.

FOLIO REV: AA

DWG REV: 7

3-Remove sand and plugs

4-Scribe part # and batch # using vibrating stylus as per Dwg D407-667-245

Inside of Cuff(Donot engrave on outside of tube)

130

QC1- Inspect dimensions to dimension sheet

0.00

130

QC

Memo

0.00

Quality Control

1 0

12/08/26

1 0

12/08/26

NCR: Yes / No

WORK ORDER NON-CONFORMANCE / UPDATE

DQA: _____ Date: _____

QA Closed: _____ Date: _____

Work Order: _____ Part No. _____ NCR No. _____	DISPOSITION Rework <input type="checkbox"/> Scrap <input type="checkbox"/> Use-as-is <input type="checkbox"/> Work Order Update <input type="checkbox"/>	AGAINST DEPARTMENT/PROCESS <table style="width: 100%;"> <tr> <td>Skid-tube <input type="checkbox"/></td> <td>Crosstube <input type="checkbox"/></td> <td>Prod. Eng. Coord. <input type="checkbox"/></td> <td>Engineering <input type="checkbox"/></td> </tr> <tr> <td>Machining <input type="checkbox"/></td> <td>Small Fab <input type="checkbox"/></td> <td>Rec/Store/Packaging <input type="checkbox"/></td> <td>Quality <input type="checkbox"/></td> </tr> <tr> <td>Thermoforming <input type="checkbox"/></td> <td>Finishing <input type="checkbox"/></td> <td>Supplier <input type="checkbox"/></td> <td></td> </tr> <tr> <td>Large Fab <input type="checkbox"/></td> <td>Composite <input type="checkbox"/></td> <td>Other <input type="checkbox"/></td> <td></td> </tr> </table>	Skid-tube <input type="checkbox"/>	Crosstube <input type="checkbox"/>	Prod. Eng. Coord. <input type="checkbox"/>	Engineering <input type="checkbox"/>	Machining <input type="checkbox"/>	Small Fab <input type="checkbox"/>	Rec/Store/Packaging <input type="checkbox"/>	Quality <input type="checkbox"/>	Thermoforming <input type="checkbox"/>	Finishing <input type="checkbox"/>	Supplier <input type="checkbox"/>		Large Fab <input type="checkbox"/>	Composite <input type="checkbox"/>	Other <input type="checkbox"/>	
Skid-tube <input type="checkbox"/>	Crosstube <input type="checkbox"/>	Prod. Eng. Coord. <input type="checkbox"/>	Engineering <input type="checkbox"/>															
Machining <input type="checkbox"/>	Small Fab <input type="checkbox"/>	Rec/Store/Packaging <input type="checkbox"/>	Quality <input type="checkbox"/>															
Thermoforming <input type="checkbox"/>	Finishing <input type="checkbox"/>	Supplier <input type="checkbox"/>																
Large Fab <input type="checkbox"/>	Composite <input type="checkbox"/>	Other <input type="checkbox"/>																

Root Cause	Date	Step	Qty	Description of work order update or Non-conformance	Initial Chief Eng	Action Description	Sign & Date	Verification	QC Inspector
Doc/Data									
Equip/Tooling									
Operator									
Material									
Offset/Setup									
Other									
Process									
Supplier									
Training									
Unauthorized									

FAULT CATEGORY

Landing Gear	Hardware	General	Other
<input type="checkbox"/> Bending Passes Below Min <input type="checkbox"/> Centre Not Concentric to O/S <input type="checkbox"/> Cracks <input type="checkbox"/> Crushed/Crimp at Bending <input type="checkbox"/> Inspection Strip in Tube <input type="checkbox"/> Other <input type="checkbox"/> Positioned Wrong <input type="checkbox"/> Ripples on Inner Bend <input type="checkbox"/> Torque Waves in Extrusion <input type="checkbox"/> Turning Sequence <input type="checkbox"/> Wave/Twist in Tube	<input type="checkbox"/> Breaking <input type="checkbox"/> Missing <input type="checkbox"/> Size/Length <input type="checkbox"/> Spinning <input type="checkbox"/> Threading <input type="checkbox"/> Wrong Drill Holes <input type="checkbox"/> Misaligned <input type="checkbox"/> Ovalized <input type="checkbox"/> Over/Undersized <input type="checkbox"/> Too Many	<input type="checkbox"/> Burrs <input type="checkbox"/> Contamination <input type="checkbox"/> Cut Too Short <input type="checkbox"/> Documentation/Data <input type="checkbox"/> Finish <input type="checkbox"/> Inspection Incomplete <input type="checkbox"/> Inspection Unqualified <input type="checkbox"/> Instructions Incomplete/Unclear <input type="checkbox"/> Jigs/Fixtures/Tooling <input type="checkbox"/> Kit Incorrect <input type="checkbox"/> Kit Missing	<input type="checkbox"/> Maintenance <input type="checkbox"/> Mislabeled <input type="checkbox"/> Off-Set <input type="checkbox"/> Orientation Misread <input type="checkbox"/> Out of Calibration <input type="checkbox"/> Out of Sequence <input type="checkbox"/> Outside Dimensions <input type="checkbox"/> Over/Under tolerance <input type="checkbox"/> Part Lost <input type="checkbox"/> Part Moved <input type="checkbox"/> Raw Material <input type="checkbox"/> Set-up <input type="checkbox"/> Supplier <input type="checkbox"/> Temperature/Cure <input type="checkbox"/> Weld <input type="checkbox"/> Wrong Stock Pulled <input type="checkbox"/> Other

Work Order ID 85322

85322

Page 3

June-05-12 3:38:09 PM

Item ID: D407-667-205TRN

Accept

N900040100

Setup Start ***NS1***

Revision ID:

Item Name: Crosstube Turning Detail

Stop ***NS2***

Start Date: 05/06/2012 Start Qty: 1.00 ***1***

Cust Item ID:

Required Date: 19/06/2012 Req'd Qty: 1.00 ***1***

Customer:

Reference:

Approvals: Process Plan: Date: Tooling: Date:

Run Start ***NR1***

QC: Date: SPC (Y/N): Date:

Stop ***NR2***

Sequence ID/ Work Center ID	Operation Description	Set Up/ Run Hours	Tool ID	Tool #	Plan Code	Accept Qty	Reject Qty	Reject Number	Insp. Stamp
--------------------------------	--------------------------	----------------------	---------	--------	--------------	---------------	---------------	------------------	----------------

140 QC8- Inspect parts - second check

0.00

140

QC

Memo

0.00

Quality Control



JW
12-8-27

145 0.00

145

Crosstubes

Memo

0.00

Crosstubes

Grind off circumferential machining marks longitudinally.

12-9-14

150 ~~Crosstubes Chemical Conversion~~ 0.00

150

HandFXtube

Memo

0.00

Hand Finishing Crosstubes

Ensure no sand is in the tube before alodine.

1- Pressure wash x-tube inside and out
2- Acid etch x-tube inside and out
Use Red scotch write.

DC 12/09/17

NCR: Yes / No

WORK ORDER NON-CONFORMANCE / UPDATE

DQA: _____ Date: _____

QA Closed: _____ Date: _____

Work Order: _____ Part No. _____ NCR No. _____	DISPOSITION Rework <input type="checkbox"/> Scrap <input type="checkbox"/> Use-as-is <input type="checkbox"/> Work Order Update <input type="checkbox"/>	AGAINST DEPARTMENT/PROCESS <table style="width: 100%;"> <tr> <td>Skid-tube <input type="checkbox"/></td> <td>Crosstube <input type="checkbox"/></td> <td>Prod. Eng. Coord. <input type="checkbox"/></td> <td>Engineering <input type="checkbox"/></td> </tr> <tr> <td>Machining <input type="checkbox"/></td> <td>Small Fab <input type="checkbox"/></td> <td>Rec/Store/Packaging <input type="checkbox"/></td> <td>Quality <input type="checkbox"/></td> </tr> <tr> <td>Thermoforming <input type="checkbox"/></td> <td>Finishing <input type="checkbox"/></td> <td>Supplier <input type="checkbox"/></td> <td></td> </tr> <tr> <td>Large Fab <input type="checkbox"/></td> <td>Composite <input type="checkbox"/></td> <td>Other <input type="checkbox"/></td> <td></td> </tr> </table>	Skid-tube <input type="checkbox"/>	Crosstube <input type="checkbox"/>	Prod. Eng. Coord. <input type="checkbox"/>	Engineering <input type="checkbox"/>	Machining <input type="checkbox"/>	Small Fab <input type="checkbox"/>	Rec/Store/Packaging <input type="checkbox"/>	Quality <input type="checkbox"/>	Thermoforming <input type="checkbox"/>	Finishing <input type="checkbox"/>	Supplier <input type="checkbox"/>		Large Fab <input type="checkbox"/>	Composite <input type="checkbox"/>	Other <input type="checkbox"/>	
Skid-tube <input type="checkbox"/>	Crosstube <input type="checkbox"/>	Prod. Eng. Coord. <input type="checkbox"/>	Engineering <input type="checkbox"/>															
Machining <input type="checkbox"/>	Small Fab <input type="checkbox"/>	Rec/Store/Packaging <input type="checkbox"/>	Quality <input type="checkbox"/>															
Thermoforming <input type="checkbox"/>	Finishing <input type="checkbox"/>	Supplier <input type="checkbox"/>																
Large Fab <input type="checkbox"/>	Composite <input type="checkbox"/>	Other <input type="checkbox"/>																

Root Cause	Date	Step	Qty	Description of work order update or Non-conformance	Initial Chief Eng	Action Description	Sign & Date	Verification	QC Inspector
Doc/Data									
Equip/Tooling									
Operator									
Material									
Offset/Setup									
Other									
Process									
Supplier									
Training									
Unauthorized									

FAULT CATEGORY

Landing Gear <input type="checkbox"/> Bending Passes Below Min <input type="checkbox"/> Centre Not Concentric to O/S <input type="checkbox"/> Cracks <input type="checkbox"/> Crushed/Crimp at Bending <input type="checkbox"/> Inspection Strip in Tube <input type="checkbox"/> Other <input type="checkbox"/> Positioned Wrong <input type="checkbox"/> Ripples on Inner Bend <input type="checkbox"/> Torque Waves in Extrusion <input type="checkbox"/> Turning Sequence <input type="checkbox"/> Wave/Twist in Tube	Hardware <input type="checkbox"/> Breaking <input type="checkbox"/> Missing <input type="checkbox"/> Size/Length <input type="checkbox"/> Spinning <input type="checkbox"/> Threading <input type="checkbox"/> Wrong Drill Holes <input type="checkbox"/> Misaligned <input type="checkbox"/> Ovalized <input type="checkbox"/> Over/Undersized <input type="checkbox"/> Too Many	General <input type="checkbox"/> Burrs <input type="checkbox"/> Contamination <input type="checkbox"/> Cut Too Short <input type="checkbox"/> Documentation/Data <input type="checkbox"/> Finish <input type="checkbox"/> Inspection Incomplete <input type="checkbox"/> Inspection Unqualified <input type="checkbox"/> Instructions Incomplete/Unclear <input type="checkbox"/> Jigs/Fixtures/Tooling <input type="checkbox"/> Kit Incorrect <input type="checkbox"/> Kit Missing	<input type="checkbox"/> Maintenance <input type="checkbox"/> Mislabeled <input type="checkbox"/> Off-Set <input type="checkbox"/> Orientation Misread <input type="checkbox"/> Out of Calibration <input type="checkbox"/> Out of Sequence <input type="checkbox"/> Outside Dimensions <input type="checkbox"/> Over/Under tolerance <input type="checkbox"/> Part Lost <input type="checkbox"/> Part Moved <input type="checkbox"/> Raw Material <input type="checkbox"/> Set-up <input type="checkbox"/> Supplier <input type="checkbox"/> Temperature/Cure <input type="checkbox"/> Weld <input type="checkbox"/> Wrong Stock Pulled <input type="checkbox"/> Other
---	--	---	---

Work Order ID 85322

85322

Page 4

June-05-12 3:38:09 PM

Item ID: D407-667-205TRN

Accept

N900040100

Setup Start ***NS1***

Revision ID:

Item Name: Crosstube Turning Detail

Stop ***NS2***

Start Date: 05/06/2012 Start Qty: 1.00

1

Cust Item ID:

Required Date: 19/06/2012 Req'd Qty: 1.00

1

Customer:

Reference:

Approvals: Process Plan:

Date:

Tooling:

Date:

Run Start ***NR1***

QC:

Date:

SPC (Y/N):

Date:

Stop ***NR2***

Sequence ID/
Work Center ID

Operation
Description

Set Up/
Run Hours

Tool ID

Tool #

Plan
Code

Accept
Qty

Reject
Qty

Reject
Number

Insp.
Stamp

160

160

QC

Quality Control

QC5 Inspect Chemical Conversion Coat

0.00

DAS
16
17/9/18

0.00

Memo

170

170

Packaging

Packaging

Packaging

Memo

0.00

0.00

Identify and stock in kanban rackLocation: LG

MO 12-9-18

180

180

QC

Quality Control

QC21- Final Inspection - Work Order Release

0.00

0.00

Memo

12/9/18

12/9/18

NCR: Yes / No

WORK ORDER NON-CONFORMANCE / UPDATE

DQA: _____ Date: _____

QA Closed: _____ Date: _____

Work Order: _____ Part No. _____ NCR No. _____	DISPOSITION Rework <input type="checkbox"/> Scrap <input type="checkbox"/> Use-as-is <input type="checkbox"/> Work Order Update <input type="checkbox"/>	AGAINST DEPARTMENT/PROCESS <table style="width:100%;"> <tr> <td>Skid-tube <input type="checkbox"/></td> <td>Crosstube <input type="checkbox"/></td> <td>Prod. Eng. Coord. <input type="checkbox"/></td> <td>Engineering <input type="checkbox"/></td> </tr> <tr> <td>Machining <input type="checkbox"/></td> <td>Small Fab <input type="checkbox"/></td> <td>Rec/Store/Packaging <input type="checkbox"/></td> <td>Quality <input type="checkbox"/></td> </tr> <tr> <td>Thermoforming <input type="checkbox"/></td> <td>Finishing <input type="checkbox"/></td> <td>Supplier <input type="checkbox"/></td> <td></td> </tr> <tr> <td>Large Fab <input type="checkbox"/></td> <td>Composite <input type="checkbox"/></td> <td>Other <input type="checkbox"/></td> <td></td> </tr> </table>	Skid-tube <input type="checkbox"/>	Crosstube <input type="checkbox"/>	Prod. Eng. Coord. <input type="checkbox"/>	Engineering <input type="checkbox"/>	Machining <input type="checkbox"/>	Small Fab <input type="checkbox"/>	Rec/Store/Packaging <input type="checkbox"/>	Quality <input type="checkbox"/>	Thermoforming <input type="checkbox"/>	Finishing <input type="checkbox"/>	Supplier <input type="checkbox"/>		Large Fab <input type="checkbox"/>	Composite <input type="checkbox"/>	Other <input type="checkbox"/>	
Skid-tube <input type="checkbox"/>	Crosstube <input type="checkbox"/>	Prod. Eng. Coord. <input type="checkbox"/>	Engineering <input type="checkbox"/>															
Machining <input type="checkbox"/>	Small Fab <input type="checkbox"/>	Rec/Store/Packaging <input type="checkbox"/>	Quality <input type="checkbox"/>															
Thermoforming <input type="checkbox"/>	Finishing <input type="checkbox"/>	Supplier <input type="checkbox"/>																
Large Fab <input type="checkbox"/>	Composite <input type="checkbox"/>	Other <input type="checkbox"/>																

Root Cause	Date	Step	Qty	Description of work order update or Non-conformance	Initial Chief Eng	Action Description	Sign & Date	Verification	QC Inspector
Doc/Data									
Equip/Tooling									
Operator									
Material									
Offset/Setup									
Other									
Process									
Supplier									
Training									
Unauthorized									

FAULT CATEGORY

Landing Gear	Hardware	General	
<input type="checkbox"/> Bending Passes Below Min	<input type="checkbox"/> Breaking	<input type="checkbox"/> Burrs	<input type="checkbox"/> Maintenance
<input type="checkbox"/> Centre Not Concentric to O/S	<input type="checkbox"/> Missing	<input type="checkbox"/> Contamination	<input type="checkbox"/> Mislabeled
<input type="checkbox"/> Cracks	<input type="checkbox"/> Size/Length	<input type="checkbox"/> Cut Too Short	<input type="checkbox"/> Off-Set
<input type="checkbox"/> Crushed/Crimp at Bending	<input type="checkbox"/> Spinning	<input type="checkbox"/> Documentation/Data	<input type="checkbox"/> Orientation Misread
<input type="checkbox"/> Inspection Strip in Tube	<input type="checkbox"/> Threading	<input type="checkbox"/> Finish	<input type="checkbox"/> Out of Calibration
<input type="checkbox"/> Other	<input type="checkbox"/> Wrong	<input type="checkbox"/> Inspection Incomplete	<input type="checkbox"/> Out of Sequence
<input type="checkbox"/> Positioned Wrong		<input type="checkbox"/> Inspection Unqualified	<input type="checkbox"/> Outside Dimensions
<input type="checkbox"/> Ripples on Inner Bend	Drill Holes	<input type="checkbox"/> Instructions Incomplete/Unclear	<input type="checkbox"/> Over/Under tolerance
<input type="checkbox"/> Torque Waves in Extrusion	<input type="checkbox"/> Misaligned	<input type="checkbox"/> Jigs/Fixtures/Tooling	<input type="checkbox"/> Part Lost
<input type="checkbox"/> Turning Sequence	<input type="checkbox"/> Ovalized	<input type="checkbox"/> Kit Incorrect	<input type="checkbox"/> Part Moved
<input type="checkbox"/> Wave/Twist in Tube	<input type="checkbox"/> Over/Undersized	<input type="checkbox"/> Kit Missing	<input type="checkbox"/> Raw Material
	<input type="checkbox"/> Too Many		<input type="checkbox"/> Set-up
			<input type="checkbox"/> Supplier
			<input type="checkbox"/> Temperature/Cure
			<input type="checkbox"/> Weld
			<input type="checkbox"/> Wrong Stock Pulled
			<input type="checkbox"/> Other

Picklist Print

June-05-12 3:38:12 PM

Page 1

Work Order ID: 85322

85322

Parent Item: D407-667-205TRN

D407-667-205TRN

Parent Item Name: Crosstube Turning Detail

Start Date: 05/06/2012

Required Date: 19/06/2012

Start Qty: 1.00

Required Qty: 1.00

Comments: IPP Rev:A 08-03-06 new issue DD verified by:ec
IPP Rev B 08.04.02 Removed polish EC verified by: DD
IPP Rev:C 08-08-19 revE as per dwg DD verified by:EC

Component Item ID/ Item Name	Replacement Item ID	Mfg/ Purch	Bin Item	Primary Location	Last Location	Route Seq ID	Unit of Measure	Qty on Hand	Qty per Kit	Total Qty	Qty Issued	Date Issued	Status
D6011-115		Manufactured	No			120	Each	45.0000	1	1			
										**			

D6011-115

Crosstube Material

Location	Loc Qty	Loc Code
FG	26	
	26	
LG	19	
65180	1	
67798	18	

1 man 12/08/25

NCR: Yes / No

WORK ORDER NON-CONFORMANCE / UPDATE

DQA: _____ Date: _____

QA Closed: _____ Date: _____

Work Order: _____ Part No. _____ NCR No. _____	DISPOSITION Rework <input type="checkbox"/> Scrap <input type="checkbox"/> Use-as-is <input type="checkbox"/> Work Order Update <input type="checkbox"/>		AGAINST DEPARTMENT/PROCESS <div style="display: flex; justify-content: space-between;"> <div> Skid-tube <input type="checkbox"/> Machining <input type="checkbox"/> Thermoforming <input type="checkbox"/> Large Fab <input type="checkbox"/> </div> <div> Crosstube <input type="checkbox"/> Small Fab <input type="checkbox"/> Finishing <input type="checkbox"/> Composite <input type="checkbox"/> </div> <div> Prod. Eng. Coord. <input type="checkbox"/> Rec/Store/Packaging <input type="checkbox"/> Supplier <input type="checkbox"/> Other <input type="checkbox"/> </div> <div> Engineering <input type="checkbox"/> Quality <input type="checkbox"/> <input type="checkbox"/> <input type="checkbox"/> </div> </div>			
--	---	--	---	--	--	--

Root Cause	Date	Step	Qty	Description of work order update or Non-conformance	Initial Chief Eng	Action Description	Sign & Date	Verification	QC Inspector
Doc/Data									
Equip/Tooling									
Operator									
Material									
Offset/Setup									
Other									
Process									
Supplier									
Training									
Unauthorized									

FAULT CATEGORY

Landing Gear <input type="checkbox"/> Bending Passes Below Min <input type="checkbox"/> Centre Not Concentric to O/S <input type="checkbox"/> Cracks <input type="checkbox"/> Crushed/Crimp at Bending <input checked="" type="checkbox"/> Inspection Strip in Tube <input type="checkbox"/> Other <input type="checkbox"/> Positioned Wrong <input type="checkbox"/> Ripples on Inner Bend <input type="checkbox"/> Torque Waves in Extrusion <input type="checkbox"/> Turning Sequence <input type="checkbox"/> Wave/Twist in Tube	Hardware <input type="checkbox"/> Breaking <input type="checkbox"/> Missing <input type="checkbox"/> Size/Length <input type="checkbox"/> Spinning <input type="checkbox"/> Threading <input type="checkbox"/> Wrong Drill Holes <input type="checkbox"/> Misaligned <input type="checkbox"/> Ovalized <input type="checkbox"/> Over/Undersized <input type="checkbox"/> Too Many	General <input type="checkbox"/> Burrs <input type="checkbox"/> Contamination <input type="checkbox"/> Cut Too Short <input type="checkbox"/> Documentation/Data <input type="checkbox"/> Finish <input type="checkbox"/> Inspection Incomplete <input type="checkbox"/> Inspection Unqualified <input type="checkbox"/> Instructions Incomplete/Unclear <input type="checkbox"/> Jigs/Fixtures/Tooling <input type="checkbox"/> Kit Incorrect <input type="checkbox"/> Kit Missing	<input type="checkbox"/> Maintenance <input type="checkbox"/> Mislabeled <input type="checkbox"/> Off-Set <input type="checkbox"/> Orientation Misread <input type="checkbox"/> Out of Calibration <input type="checkbox"/> Out of Sequence <input type="checkbox"/> Outside Dimensions <input type="checkbox"/> Over/Under tolerance <input type="checkbox"/> Part Lost <input type="checkbox"/> Part Moved <input type="checkbox"/> Raw Material	<input type="checkbox"/> Set-up <input type="checkbox"/> Supplier <input type="checkbox"/> Temperature/Cure <input type="checkbox"/> Weld <input type="checkbox"/> Wrong Stock Pulled <input type="checkbox"/> Other _____ _____ _____
--	--	---	--	--

DART AEROSPACE LTD	Work Order: 85522
Description: Crosstube Assembly	Part Number: D407-667-245
Inspection Dwg: D407-667-245 Rev: F	Page 1 of 1

FIRST ARTICLE INSPECTION CHECKLIST

☒ First Article ☐ Prototype


	Inspection Sheet Drawing Dimension	Tolerance	Actual Dimension	Accept	Reject	Method of Inspection	Comments
SIDE A	2.490	+0.005/-0.000	2.493	/		vern	CWC-08
	1.832	+0.005/-0.000	1.835	/			
	1.838	+0.005/-0.000	1.841	/			
	1.892	+0.005/-0.000	1.895	/			
	2.052	+0.005/-0.000	2.057	/			
	2.206	+0.005/-0.000	2.210	/			
	2.521	+0.005/-0.000	2.526	/			
	2.633	+0.005/-0.000	2.635	/			
	4.10	+/-0.030	4.10	/		vern	CWC-08
	4.978	+/-0.030	4.978	/			
	2.040	+0.000/-0.010	2.032	/			
	0.125	+/-0.010	.125	/			
	R0.063	+/-0.010	.063	/		RG	
	R0.500	+/-0.010	.500	/		"	
	2.490	+0.005/-0.000	2.494	/		vern	CWC-08
	1.832	+0.005/-0.000	1.837	/			
SIDE B	1.838	+0.005/-0.000	1.842	/			
	1.892	+0.005/-0.000	1.897	/			
	2.052	+0.005/-0.000	2.057	/			
	2.206	+0.005/-0.000	2.209	/			
	2.521	+0.005/-0.000	2.526	/			
	2.633	+0.005/-0.000	2.637	/			
	4.10	+/-0.030	4.10	/		vern	CWC-08
	4.978	+/-0.030	4.978	/			
	2.040	+0.000/-0.010	2.040	/			
	0.125	+/-0.010	.125	/			
	R0.063	+/-0.010	.063	/		RG	
	R0.500	+/-0.010	.500	/		"	
	112.91	+/-0.020	112.91	/		D407 tape	LG-22*

Measured by: mmr-l	Audited by: J. J. P. 036	Prototype Approval:	N/A
Date: 12/08/26	Date: 12-8-27	Date:	N/A

Rev	Date	Change	Revised by	Approved
A	04.04.21	New Issue (P/O D407-667-205)	KJ/RF	
B	06.03.09	Dwg Rev updated	KJ/JLM	
C	06.03.30	Tolerance revised for 4.978 dimension	KJ/JLM	
D	07.02.19	Dwg Rev updated	KJ/JLM	
E	09.05.20	Dwg Rev updated	KJ	

DART AEROSPACE LTD	Work Order:	85322
Description: Crosstube Assembly	Part Number:	D407-667-245
Inspection Dwg: D407-667-245 Rev: F		Page 2 of 2

WALL THICKNESS MEASUREMENT

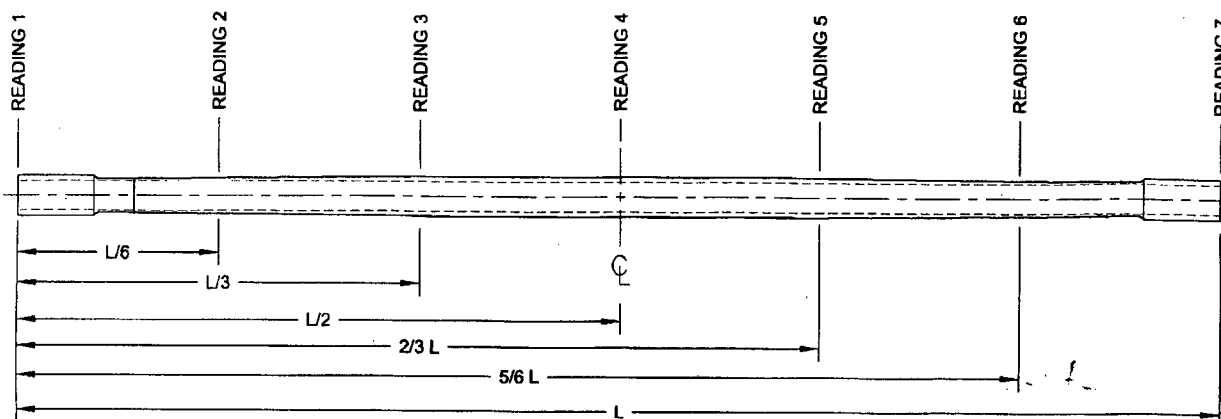

Location	WALL THICKNESS MEASUREMENT (IN)				Deviation Δw (max-min)	TOLERANCE
	w1	w2	w3	w4		
READING 1 L= 0"	.227	.226	.227	.230	.004	0.075"
READING 2 L= 17	.242	.241	.225	.228	.017	
READING 3 L= 36	.406	.411	.390	.381	.030	
READING 4 L= 56	.666	.648	.629	.648	.037	
READING 5 L= 36	.420	.408	.373	.388	.047	
READING 6 L= 17	.257	.249	.204	.223	.048	
READING 7 L= Luff	.228	.226	.229	.223	.005	

Calibration Result

Actual Block Thickness: .100-.500

Sitiescan 250 Measured Thickness: .100-.500

Measured by:	<i>gjm.l</i>
Date:	12/08/27

Audited by:	<i>JW/ID</i>
Date:	12-8-27

Preliminary Approval:	
Date:	

Rev	Date	Change	Revised by	Approved
A	04.04.21	New Issue (P/O D407-667-205)	KJ/RF	
B	06.03.09	Dwg Rev updated	KJ/JLM	
C	06.03.30	Tolerance revised for 4.978 dimension	KJ/JLM	
D	07.02.19	Dwg Rev updated	KJ/JLM	
E	09.05.20	Dwg Rev updated	KJ	
F	12.06.04	Wall thickness form added	KJ	

NCR: Yes / No

WORK ORDER NON-CONFORMANCE / UPDATE

DQA: _____ Date: _____

QA Closed: _____ Date: _____

Work Order: _____ Part No. _____ NCR No. _____				DISPOSITION Rework <input type="checkbox"/> Scrap <input type="checkbox"/> Use-as-is <input type="checkbox"/> Work Order Update <input type="checkbox"/>		AGAINST DEPARTMENT/PROCESS <table style="width:100%; border: none;"> <tr> <td style="width:25%;">Skid-tube <input type="checkbox"/></td> <td style="width:25%;">Crosstube <input type="checkbox"/></td> <td style="width:25%;">Water Jet <input type="checkbox"/></td> <td style="width:25%;">Engineering <input type="checkbox"/></td> </tr> <tr> <td>Machining <input type="checkbox"/></td> <td>Small Fab <input type="checkbox"/></td> <td>Prod. Eng. Coord. <input type="checkbox"/></td> <td>Quality <input type="checkbox"/></td> </tr> <tr> <td>Thermoforming <input type="checkbox"/></td> <td>Finishing <input type="checkbox"/></td> <td>Rec/Store/Packaging <input type="checkbox"/></td> <td>Other <input type="checkbox"/></td> </tr> <tr> <td>Large Fab <input type="checkbox"/></td> <td>Composite <input type="checkbox"/></td> <td>Supplier <input type="checkbox"/></td> <td></td> </tr> </table>						Skid-tube <input type="checkbox"/>	Crosstube <input type="checkbox"/>	Water Jet <input type="checkbox"/>	Engineering <input type="checkbox"/>	Machining <input type="checkbox"/>	Small Fab <input type="checkbox"/>	Prod. Eng. Coord. <input type="checkbox"/>	Quality <input type="checkbox"/>	Thermoforming <input type="checkbox"/>	Finishing <input type="checkbox"/>	Rec/Store/Packaging <input type="checkbox"/>	Other <input type="checkbox"/>	Large Fab <input type="checkbox"/>	Composite <input type="checkbox"/>	Supplier <input type="checkbox"/>	
Skid-tube <input type="checkbox"/>	Crosstube <input type="checkbox"/>	Water Jet <input type="checkbox"/>	Engineering <input type="checkbox"/>																								
Machining <input type="checkbox"/>	Small Fab <input type="checkbox"/>	Prod. Eng. Coord. <input type="checkbox"/>	Quality <input type="checkbox"/>																								
Thermoforming <input type="checkbox"/>	Finishing <input type="checkbox"/>	Rec/Store/Packaging <input type="checkbox"/>	Other <input type="checkbox"/>																								
Large Fab <input type="checkbox"/>	Composite <input type="checkbox"/>	Supplier <input type="checkbox"/>																									
Root Cause	Date	Step	Qty	Description of work order update or Non-conformance	Initial Chief Eng	Action Description	Sign & Date	Verification	QC Inspector																		
Doc/Data <input type="checkbox"/>																											
Equip/Tooling <input type="checkbox"/>																											
Operator <input type="checkbox"/>																											
Material <input type="checkbox"/>																											
Setup <input type="checkbox"/>																											
Other <input type="checkbox"/>																											
Process <input type="checkbox"/>																											
Supplier <input type="checkbox"/>																											
Training <input type="checkbox"/>																											
Unapproved <input type="checkbox"/>																											

FAULT CATEGORY			
Landing Gear <input type="checkbox"/> Bending <input type="checkbox"/> Centre Not Concentric to O/S <input type="checkbox"/> Cracks <input type="checkbox"/> Crushed/Crimped <input type="checkbox"/> Cuffs <input type="checkbox"/> Heat Treat <input type="checkbox"/> Inspection Strip in Tube <input type="checkbox"/> Ripples in Bend <input type="checkbox"/> Torque Waves in Extrusion <input type="checkbox"/> Turning Sequence <input type="checkbox"/> Wave/Twist in Tube	General <input type="checkbox"/> Bend <input type="checkbox"/> BOM/Route <input type="checkbox"/> Broken/Damaged <input type="checkbox"/> Burrs <input type="checkbox"/> Contamination <input type="checkbox"/> Countersink <input type="checkbox"/> Cut Too Short <input type="checkbox"/> Drill Holes <input type="checkbox"/> Drawing <input type="checkbox"/> Finish <input type="checkbox"/> Folio	<input type="checkbox"/> Grain <input type="checkbox"/> Hardware <input type="checkbox"/> Inspection Incomplete <input type="checkbox"/> Instructions Incomplete/Unclear <input type="checkbox"/> Maintenance <input type="checkbox"/> Mislabeled <input type="checkbox"/> Misread <input type="checkbox"/> Offset <input type="checkbox"/> Out of Calibration <input type="checkbox"/> Out of Sequence <input type="checkbox"/> Outside Dimensions	<input type="checkbox"/> Ovalized <input type="checkbox"/> Over/Under tolerance <input type="checkbox"/> Part Incorrect <input type="checkbox"/> Part Lost/Missing <input type="checkbox"/> Part Moved <input type="checkbox"/> Positioned Wrong <input type="checkbox"/> Power Loss/Surge <input type="checkbox"/> Pressure/Forced <input type="checkbox"/> Temperature/Cure <input type="checkbox"/> Weld <input type="checkbox"/> Wrong Stock Pulled <input type="checkbox"/> Other

Item	QTY -245	PART NUMBER	DESCRIPTION
1	X	D407-667-245	CROSSTUBE ASSEMBLY (407 HIGH AFT)
2	1	D6011-115	CROSSTUBE
3	2	D2856-400-773	ABRASION STRIP
4	2	D2873-043	NUT PLATE
5	2	D2873-045	NUT PLATE
6	1	D2894-1	SUPPORT
7	2	D3190-1	CHAFING SHIELD
8	2	D3595-063-430	RUBBER CUSHION
9	14	MS20601AD4W8	RIVET (OR NAS9302B-4-8)
10	4	MS21920-22	CLAMP
11	2	MS21920-25	CLAMP (OR MS21920-24)
12	A/R	MAGNOBOND 6398	ROCKWELL SPECIFICATION RBO-120-023 ADHESIVE (TEXTRON/BELL SPEC. 299-947- 100, TYPE II, CLASS 2 ADHESIVE)

GENERAL NOTES:

- 1) MATERIAL: MANUFACTURED FROM D6011-115
FINISHED LENGTH = 112.91±0.020
- 2) FINISH: CHEMICAL CONVERSION COAT PER DART QSI 005 4.1
PRIME INSIDE AND OUTSIDE PER DART QSI 005 4.2
PAINT OUTSIDE PER DART QSI 005 4.2
- 3) TOLERANCES ARE PER DART QSI 018 UNLESS OTHERWISE NOTED.
- 4) UNITS: INCHES UNLESS OTHERWISE NOTED.
- 5) BREAK SHARP EDGES: 0.005 TO 0.010 MAX.
- 6) IDENTIFICATION: SCRIBE DART PART NUMBER 'D407-667-245' AND BATCH NUMBER ON
INSIDE OF CUFF USING VIBRATING STYLUS.
- 7) WEIGHT: 27.7 lbs
- 8) PART IS SYMMETRIC ABOUT CENTERLINE.
- 9) RUN-OFF PART. BLEND OUT EDGE LONGITUDINALLY. TRANSITION SHOULD BE SMOOTH.
- 10) BEND PROGRESSIVELY WITH A MINIMUM OF 6 PASSES. MAXIMUM TUBE FLATTENING DUE TO
BENDING IS 6% BASED ON O.D.
- 11) LIQUID PENETRANT INSPECT OUTSIDE SURFACE OF CROSSTUBE PER QSI 038.
- 12) INSTALL D2894-1 CENTER SUPPORT USING A 0.03" TO 0.06" THICK LAYER OF MAGNOBOND
6398 PER QSI 015. LET CURE FOR 12 HOURS AFTER INSTALLATION AND PRIOR TO
PACKAGING.
- 13) INSTALL MS21920-25 CLAMPS WITH D3595-063-430 RUBBER CUSHIONS TO SECURE D2894-1
SUPPORT ON TOP SIDE OF THE CROSSTUBE. ENSURE CLAMPS ARE OPPOSITE CROSSTUBE
SUPPORT.
NOTE: MS21920-24 CLAMPS CAN BE USED TO ACCOMMODATE VARYING DIAMETERS.
ENSURE THERE IS A MINIMUM OF 1.5 THREADS IN SAFETY ON THE NUTS.
- 14) EXTREME CARE MUST BE TAKEN TO PROTECT THE OUTSIDE SURFACE OF THE TUBE. THE
OUTSIDE SURFACE MUST BE SMOOTH AND FREE FROM SURFACE DEFECTS SUCH AS
SCRATCHES, NICKS, OR DENTS. DEFECTS UP TO 0.005" MAY BE BLENDED OUT
LONGITUDINALLY. CIRCUMFERENTIAL GRIND MARKS ARE UNACCEPTABLE.
- 15) INSTALL D2856-400-773 ABRASION STRIP WITH A 0.13 (REF) GAP ON BOTTOM SIDE OF
CROSSTUBE, PER QSI 035.
- 16) INSTALL D3190-1 CHAFING SHIELDS SO THAT OVERLAP IS ON BOTTOM SIDE OF CROSSTUBE
OPPOSITE D2894-1 SUPPORT.
- 17) TORQUE CLAMPS 80 TO 100 IN-LB. ENSURE AT LEAST 1.5 THREADS ARE SHOWING IN
SAFETY AND THAT NUT HAS NOT BOTTOMED-OUT AFTER TORQUING.


SHOP COPY
RETURN TO
ENGINEERING
UNCONTROLLED COPY
SUBJECT TO AMENDMENT

WITHOUT NOTICE
WORK ORDER
NO. 85322 MCT
12/06/06


DEO ATTACHED

RELEASED
8/11/12


F	REFORMAT NOTES TO NEW STANDARDS (ZN B8-1); RELOCATED FLAG # 6 (ZN A8-3) PER NCR 210; REMOVED REF. & ADD TOLERANCES (ZN C6-3, C4-3 & D2-3)	RF	08.11.06
E	8.02 AND 8.53 WERE 8.40 AND 8.90 (ZN D5-2); REORGANIZED VIEWS AND REFORMATED DRAWING TO CURRENT STANDARDS. REASONS: CLAMPS MOVED 0.375 TOWARD CL TO ELIMINATE INTERFERENCE WITH AIRCRAFT MOUNTS. REFERENCE: FAR#08-21 AND ECR#1225	MB	08.07.24
D	ADD VIEW FOR OEM SKID HOLES, ROTATE ORIENTATION OF CLAMPS SECTION F-F, REMOVE -851 ABRASION STRIP, ADD MAGNOBOND 6398, ADD CUSHION	PH	07.02.07
C	ADD HOLES AND NUT PLATES FOR COMPATIBILITY WITH BHT/AA SKIDTUBES	PH	05.07.26
B	ADD CHAFING SHIELD	CP	03.05.21
A	NEW ISSUE	CP	02.05.13
REV.	DESCRIPTION	BY	DATE
DESIGN	RF	DART AEROSPACE LTD HAWKESBURY, ONTARIO, CANADA DRAWING NO. D407-667-245 REV. F SHEET 1 OF 4 TITLE CROSSTUBE ASS'Y (407 HIGH AFT) SCALE NTS <small>COPYRIGHT © 2002 BY DART AEROSPACE LTD THIS DOCUMENT IS PRIVATE AND CONFIDENTIAL AND IS SUPPLIED ON THE EXPRESS CONDITION THAT IT IS NOT TO BE USED FOR ANY PURPOSE OR COPIED OR COMMUNICATED TO ANY OTHER PERSON WITHOUT WRITTEN PERMISSION FROM DART AEROSPACE LTD.</small>	
DRAWN	RF		
CHECKED	RF		
MFG. APPR.	RF		
APPROVED	RF		
DE APPR.	RF		
DATE	08.11.06		

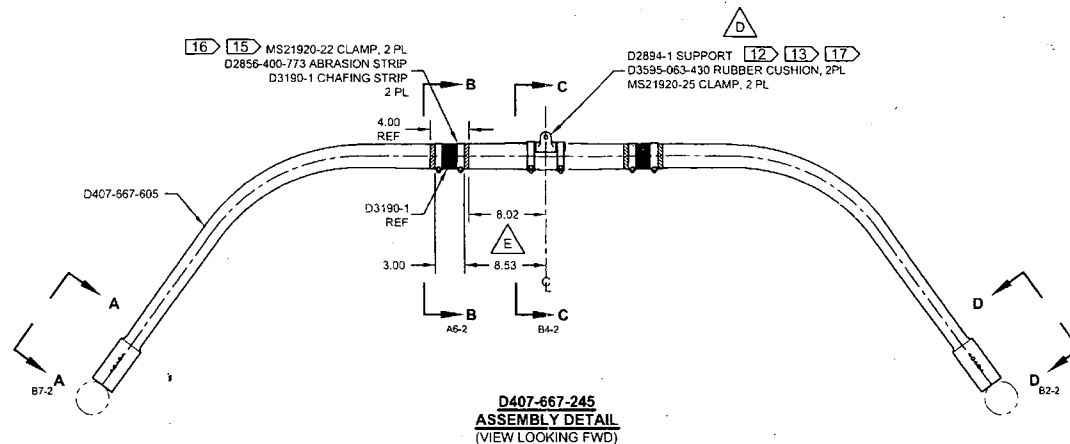


D407-667-245
ASSEMBLY DETAIL
(VIEW LOOKING FWD)

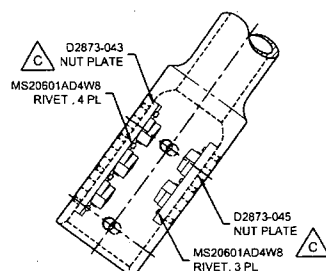


VIEW A-A CUFF DETAIL
SCALE 4X

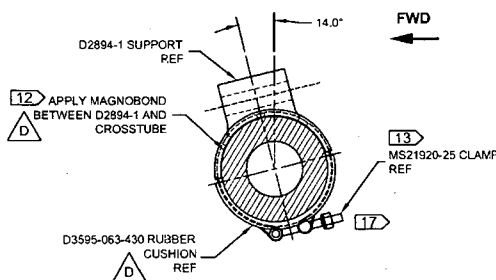

SECTION C-C
SCALE 4X

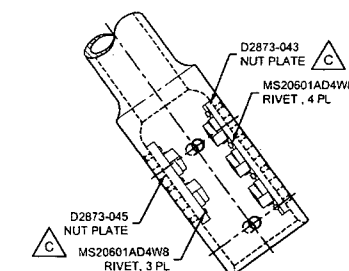

VIEW D-D CUFF DETAIL
SCALE 4X

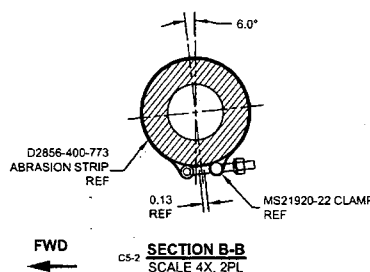


SECTION B-B
SCALE 4X, 2PL


DEO ATTACHED
RELEASED
08/11/06

DESIGN	97	DART AEROSPACE LTD	
DRAWN	RF	HAWKESBURY, ONTARIO, CANADA	
CHECKED	RF	DRAWING NO.	REV. F
MFG. APPR.	RF	D407-667-245	SHEET 2 OF 4
APPROVED	RF	TITLE	SCALE
DE APPR.	RF	CROSSTUBE ASS'Y (407 HIGH AFT)	NTS
DATE	08.11.06	COPYRIGHT © 2002 BY DART AEROSPACE LTD THIS DOCUMENT IS PRIVATE AND CONFIDENTIAL AND IS SUPPLIED ON THE EXPRESS CONDITION THAT IT IS NOT TO BE USED FOR ANY PURPOSE OR COPIED OR COMMUNICATED TO ANY OTHER PERSON WITHOUT WRITTEN PERMISSION FROM DART AEROSPACE LTD.	


05322

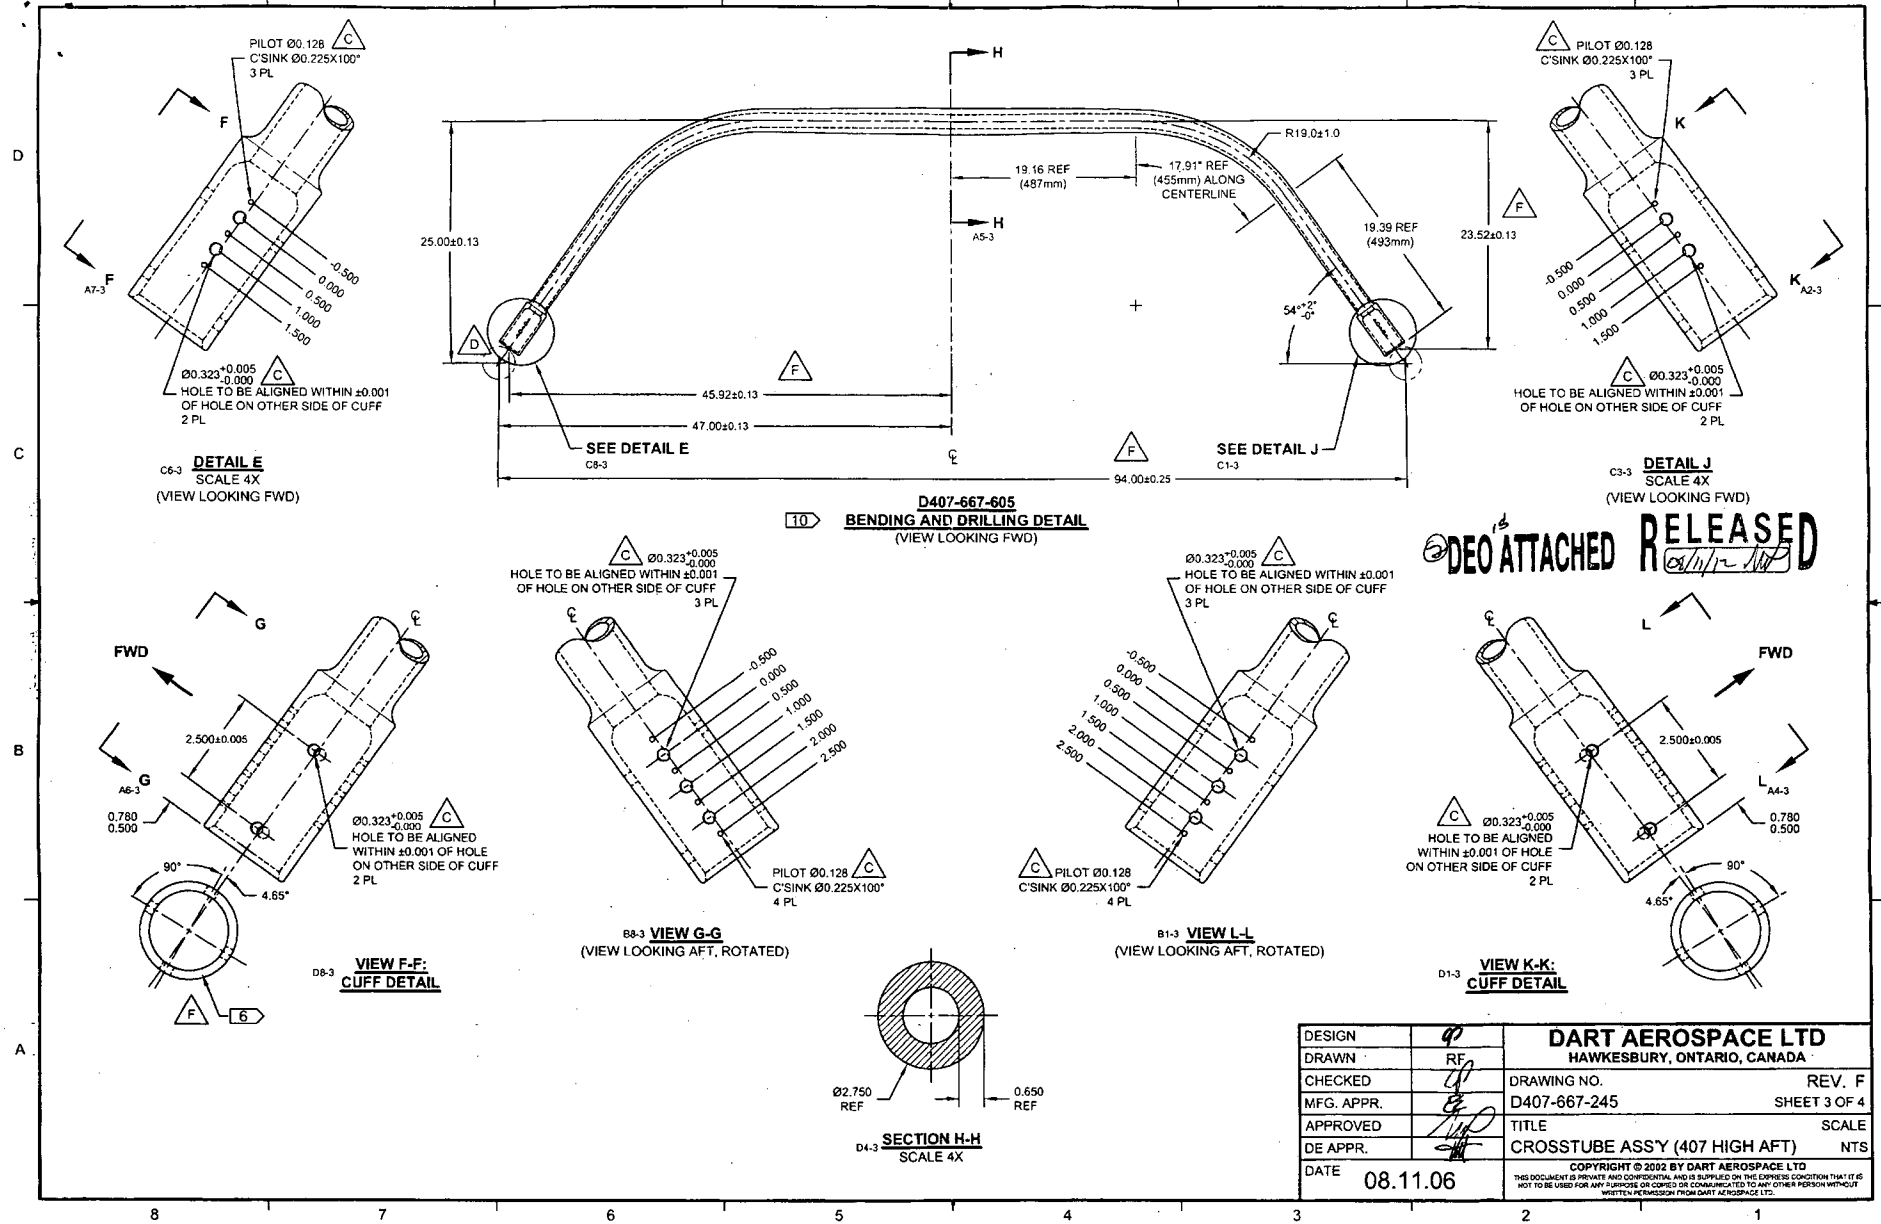


SEE DETAIL M
A7-4

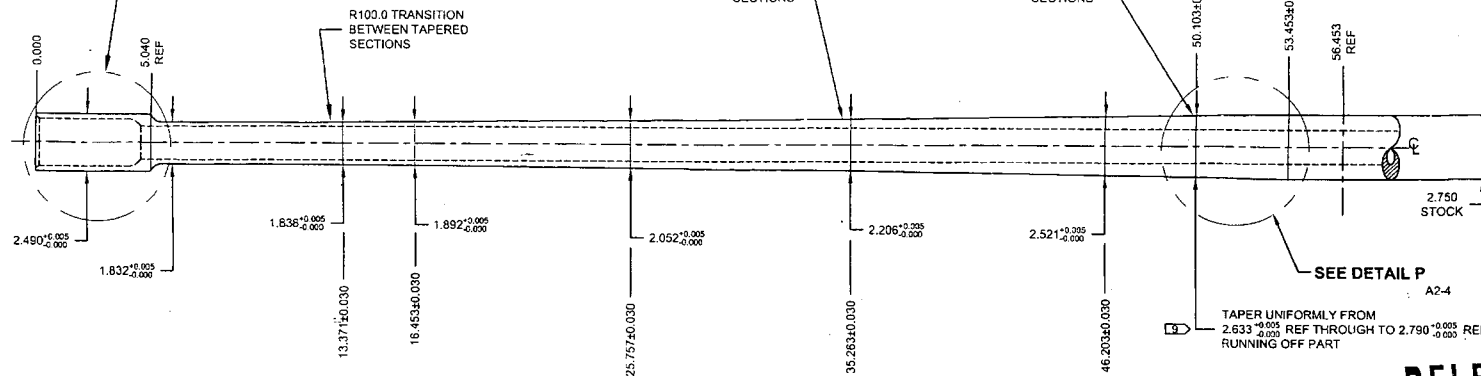


D407-667-245 MACHINING DETAIL

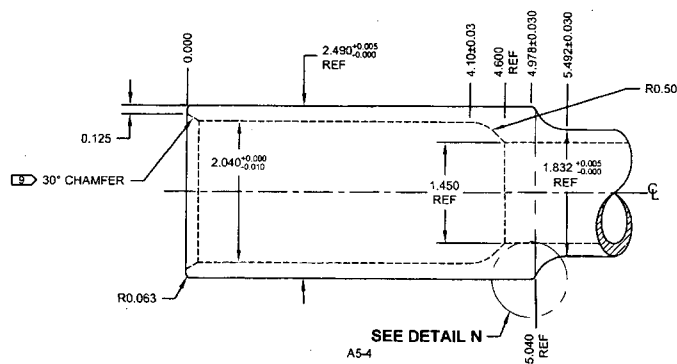

DETAIL M: CROSSTUBE CUFF
SCALE 3X

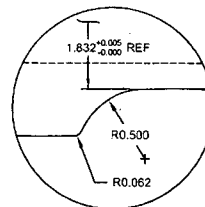

DETAIL N: CUFF TRANSITION
SCALE 2X

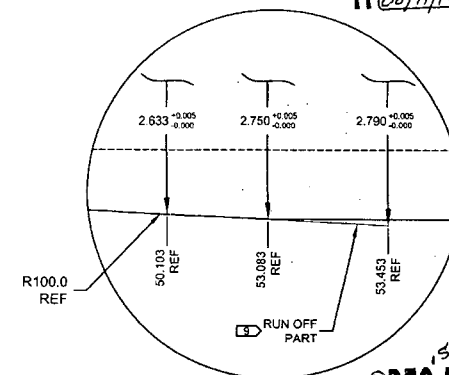

DETAIL P: TAPER RUN-OFF
NOT TO SCALE

RELEASED
08/11/12

DEO ATTACHED

DESIGN	90	DART AEROSPACE LTD	
DRAWN	RF	HAWKESBURY, ONTARIO, CANADA	
CHECKED	90	DRAWING NO.	REV. F
MFG. APPR.	90	D407-667-245	SHEET 4 OF 4
APPROVED	90	TITLE	SCALE
DE APPR.	90	CROSSTUBE ASS'Y (407 HIGH AFT)	NTS
DATE	08.11.06	<small>COPYRIGHT © 2002 BY DART AEROSPACE LTD. THIS DOCUMENT IS PRIVATE AND CONFIDENTIAL AND IS SUPPLIED ON THE EXPRESS CONDITION THAT IT IS NOT TO BE USED FOR ANY PURPOSE OR COPIED OR COMMUNICATED TO ANY OTHER PERSON WITHOUT WRITTEN PERMISSION FROM DART AEROSPACE LTD.</small>	

DRAWING NO. D407-667-245	TITLE CROSSTUBE ASSY (407 HIGH AFT)	REV. F	DART AEROSPACE LTD ENGINEERING ORDER		D.E.O. NO. D407-667-245-F-1	SHEET NO. SHEET 1 OF 2	SCALE NTS
DRAWN <i>3</i>	CHECKED <i>90</i>	MFG. APPR. <i>E</i>	APPROVED <i>140</i>	DE APPR. <i>14</i>			
DATE 11.04.08	DATE 11.04.12	DATE 11.04.12	DATE 11.04.12	DATE 11.04.12	DATE 11.04.12		

PURPOSE:

REMOVED ABRASION STRIP IN FAVOR OF A THIN LAYER OF PROSEAL 890.

CHANGE:

PARTS LIST IS AMENDED AS FOLLOWS:

IS:

Item	Qty -245	Part Number	Description
3	0	D2856-400-773	ABRASION STRIP

WAS:

3	2	D2856-400-773	ABRASION STRIP
---	---	---------------	----------------

NOTES 2 AND 15, SHEET 1 ARE AMENDED AS FOLLOWS:

IS:

- 2) FINISH: CHEMICAL CONVERSION COAT PER DART QSI 005 4.1
PRIME INSIDE AND OUTSIDE PER DART QSI 005 4.2
MASK UNDERSIDE OF CROSSTUBE AS SHOWN (HATCHED AREA) AND
PAINT OUTSIDE PER DART QSI 005 4.2
REMOVE MASKING AND APPLY CLEAR COAT
- 15) APPLY A THIN COAT OF PROSEAL 890 ON INSIDE CONCAVE SURFACE OF D3190-1
CHAFING SHIELDS AND LET CURE PER MANUFACTURER'S INSTRUCTIONS. INSTALL
PROSEALED D3190-1 CHAFING SHIELDS ONTO CROSSTUBE BY APPLYING A THIN COAT
OF PROSEAL 890 ONTO CROSSTUBE. BE SURE TO ELIMINATE ANY AIR GAPS.

WAS:

- 2) FINISH: CHEMICAL CONVERSION COAT PER DART QSI 005 4.1
PRIME INSIDE AND OUTSIDE PER DART QSI 005 4.2
PAINT OUTSIDE PER DART QSI 005 4.2
- 15) INSTALL D2856-400-773 ABRASION STRIP WITH A 0.13 REF GAP ON BOTTOM SIDE OF
CROSSTUBE PER QSI 035.

85322
RELEASED
2011-04-18
MD

COPYRIGHT © 2011 BY DART AEROSPACE LTD

THIS DOCUMENT IS PRIVATE AND CONFIDENTIAL AND IS SUPPLIED ON THE EXPRESS CONDITION THAT IT IS
NOT TO BE USED FOR ANY PURPOSE OR COPIED OR COMMUNICATED TO ANY OTHER PERSON WITHOUT
WRITTEN PERMISSION FROM DART AEROSPACE LTD


05322

DRAWING NO. D407-667-245	TITLE CROSSTUBE ASSY (407 HIGH AFT)	REV. F	DART AEROSPACE LTD ENGINEERING ORDER	D.E.O. NO. D407-667-245-F-1	SHEET NO. SHEET 2 OF 2	SCALE NTS
DRAWN	CHECKED	MFG. APPR.	APPROVED	DE APPR.		
DATE 11.04.08	DATE 11.04.11	DATE 11.04.12	DATE 11/04/12	DATE 11.04.12		

IS:

WAS:

RELEASED
2011-04-10

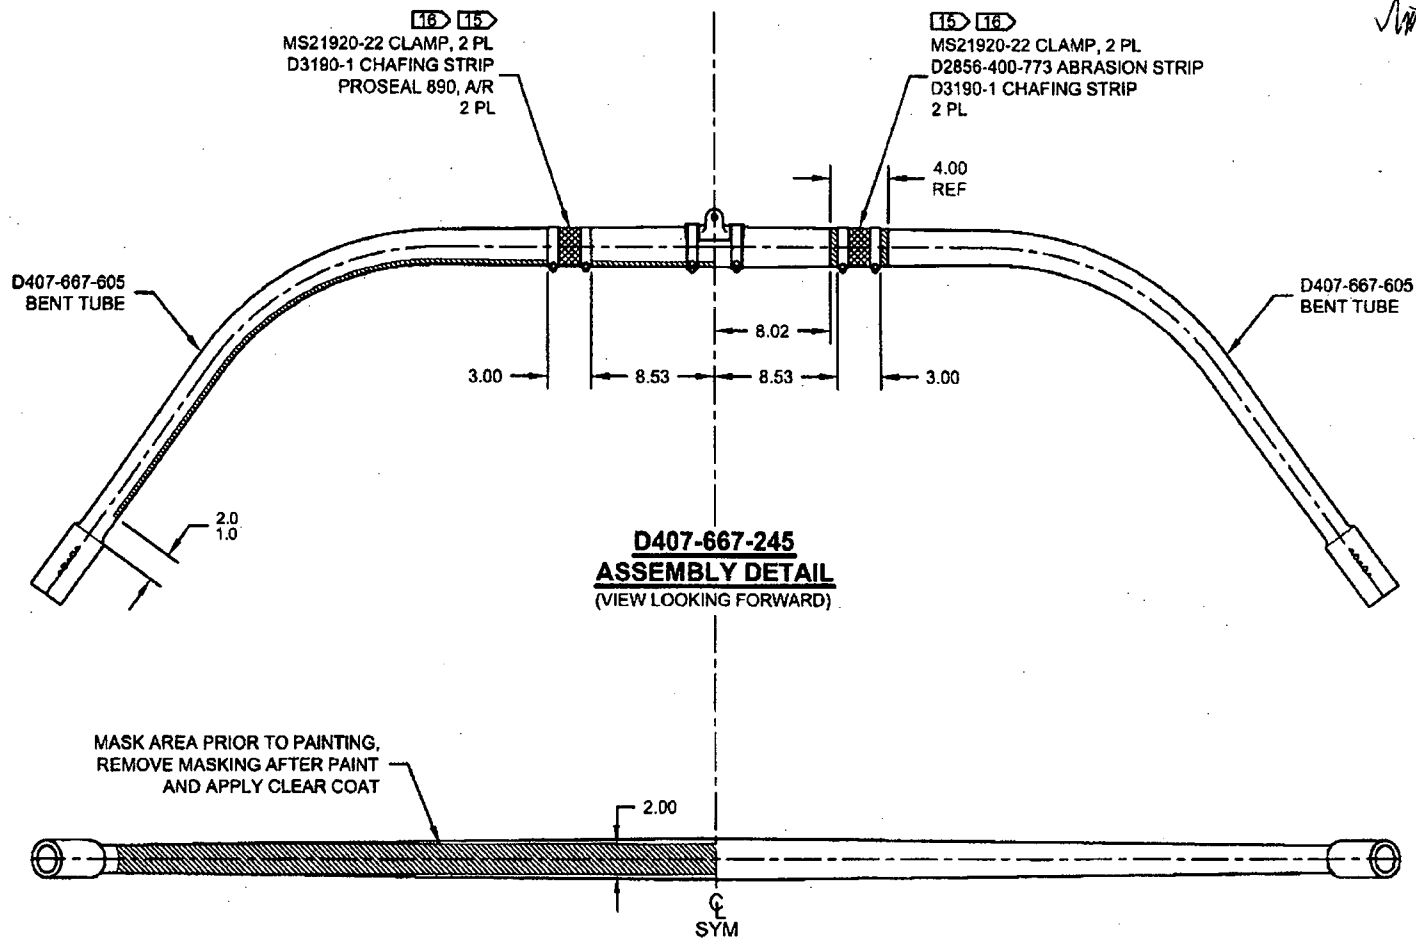

25322

DRAWING NO. D407-667-245	TITLE CROSSTUBE ASS'Y (407 HIGH AFT)	REV. F	DART AEROSPACE LTD ENGINEERING ORDER		D.E.O. NO. D407-667-245-F-2	SHEET NO. SHEET 1 OF 1	SCALE NTS
DRAWN 92	CHECKED ASS	MFG. APPR. E	APPROVED MP		DE APPR. H		
DATE 11.09.07	DATE 11.09.19	DATE 11.09.19	DATE 11.09.19		DATE 11.09.19		

PURPOSE:

REPLACE MAGNOBOND WITH 3M DP460 SCOTCH-WELD EPOXY ADHESIVE

CHANGE:

IS:

Item	Qty -245	Part Number	Description
12	A/R	SCOTCH-WELD DP460	EPOXY ADHESIVE, 3M SCOTCH-WELD

WAS:

12	A/R	MAGNOBOND 6398	ROCKWELL SPECIFICATION RBO-120-023 ADHESIVE (TEXTRON/BELL SPEC. 299-947-100, TYPE II, CLASS 2 ADHESIVE)
----	-----	----------------	---

NOTE 12 & 17, SHEET 1 IS AMENDED AS FOLLOWS:

IS:

- 12) INSTALL D2894-1 CENTER SUPPORT USING A 0.04" TO 0.07" THICK LAYER OF SCOTCH-WELD DP460 PER QSI 015. LET CURE FOR 24 HOURS AFTER INSTALLATION AND PRIOR TO PACKAGING.
- 15) TORQUE CLAMPS 80 TO 100 IN-LB. ENSURE AT LEAST 1.5 THREADS SHOWING IN SAFETY AND THAT NUT HAS NOT BOTTOMED-OUT AFTER TORQUING. PRIOR TO PACKAGING, RE-CHECK TORQUE ON CLAMPS AFTER ADHESIVE HAS CURED FOR 24 HOURS.

WAS:

- 12) INSTALL D2894-1 CENTER SUPPORT USING A 0.03" TO 0.06" THICK LAYER OF MAGNOBOND 6398 PER QSI 015. LET CURE FOR 12 HOURS AFTER INSTALLATION AND PRIOR TO PACKAGING.
- 15) TORQUE CLAMPS 80 TO 100 IN-LB. ENSURE AT LEAST 1.5 THREADS ARE SHOWING IN SAFETY AND THAT NUT HAS NOT BOTTOMED-OUT AFTER TORQUING.

RELEASED
2011-09-29
MP

